


3M™ Scotchkote™ Hot Melt Patch Compounds - 226P

Instructions

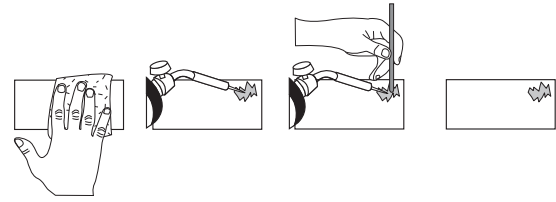

Product Description

3M Scotchkote™ Hot Melt Patch Compounds, (H.M.P.C.) are heat bondable polymeric coatings in stick form designed for plant and field repair of Scotchkote Fusion Bonded Epoxy Coatings. Scotchkote Hot Melt Patch Compounds are ideal for repairing minor pinholes and abrasions. Scotchkote 226P H.M.P.C. is colormatched to Scotchkote 226N and 6233.

Scotchkote 226P H.M.P.C. can be used on holidays where no steel is visible. The following 3M two-part epoxies should be used for bare steel areas larger than pinholes, depending on the functional and application properties required:

Scotchkote 323 Scotchkote 323i

Scotchkote 352 Scotchkote 327

Features

- Easy to apply
- Usable in all weather conditions
- Quick setting for immediate installation and handling
- No solvents
- No mixing, metering, or pot life problems
- Flexible
- Color matched to Scotchkote fusion bonded epoxy coatings
- Maximum operating temperature 122°F/50°C
- Patch sticks are recommended to repair pin holes, however they can be used to repair other coating defects at the discretion of the end user.

3M and Scotchkote are trademarks of 3M Company.

Important Notice

All statements, technical information, and recommendations related to 3M's products are based on information believed to be reliable, but the accuracy or completeness is not guaranteed. Before using this product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use. Any statements related to the product which are not contained in 3M's current publications, or any contrary statements contained on your purchase order shall have no force or effect unless expressly agreed upon, in writing, by an authorized officer of 3M.

Warranty; Limited Remedy; Limited Liability.

This product will be free from defects in material and manufacture for a period of 24 months from the date of purchase. **3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.** If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. **Except where prohibited by law, 3M will not be liable for any loss or damage arising from this 3M product, whether indirect, special, incidental or consequential regardless of the legal theory asserted.**



Corrosion Protection Department

6801 River Place Blvd.
Austin, TX 78726-9000
www.3M.com/corrosion

Please recycle. Printed in USA.
© 3M 2008. All rights reserved.
80-6111-8325-4 Rev F

General Application Steps

1. Roughen the surface of the parent FBE coating using 80-mesh to 120-mesh sandpaper. Clean the surface and wipe away the sanding residue with a non-contaminating cloth.
2. Preheat the parent-coating surface using a non-contaminating heat source, such as portable hand-held butane torch. Heat should be applied in a manner that avoids burning or charring of the epoxy coating. Slight browning of the parent coating is acceptable, but charring or blistering is not. Avoid heat application directly to the patchstick while prewarming the coating surface.
3. While continuing to heat the FBE surface, occasionally draw the patchstick across the repair area until it leaves a residue. Then rub the stick in a circular motion and utilize the torch to help melt it and maintain the pipecoating temperature. Continue until the patch is smooth and has a thickness of at least 15 mils (380 microns) greater than the parent coating.
4. Allow the patch to cool before handling.

Ordering Information/Customer Service

For ordering information, technical information, product information or to request a copy of the Material Safety Data Sheet:

Phone: 800/722-6721 or 512/984-9385

Fax: 877/601-1305 or 512/984-6296

Handling and Safety Precautions

Read all Health Hazard, Precautionary, and First Aid statements found in the Material Safety Data Sheet, and/or product label of chemicals prior to handling or use.

